FORM D-53702 ISSUE- [redacted] 15

RINGER FREQ. L 5100 E30

CODE NO.

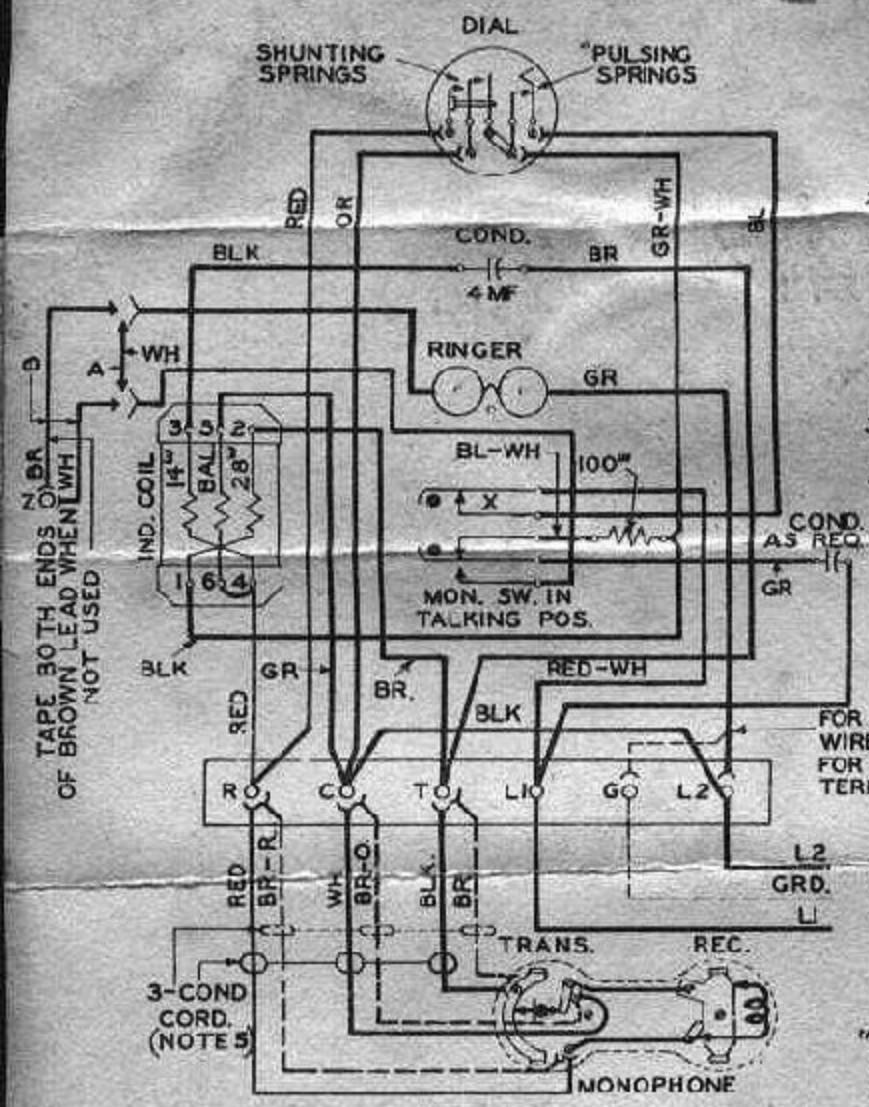

NOTES

1- IF NO DIAL IS USED PUT BOTH GR-WH & BL DIAL WIRES UNDER DIAL MTG. SCREW ON DIAL BRACKET.

2- IF BELLS TAP WHEN DIALING FROM ANOTHER TELEPHONE ON THE LINE, REVERSE CONNECTIONS TO THE RINGER. USE "B" WIRING & REVERSE WIRES AT TERMINALS Z & L2 WHEN WIRES AT RINGER ARE SOLDERED. USE "A" WIRING AND REVERSE WIRES AT RINGER WHEN SPADE TERMINALS ARE FURNISHED AT RINGER.

3- X CONTACTS TO BREAK FIRST & MAKE LAST

4- FOR CAPACITANCE SEE STAMPING ON CONDENSERS.

5- DOTTED HANDSET WIRING INDICATES CONNECTIONS FOR BRAIDED COTTON COVERED CORDS.

FOR METALLIC RING. CONNECT GR. WIRE TO TERM. L2.
FOR GROUND RING. CONNECT TO TERM. G.
RED TO TERM. R

"HANDSET WITH TRANSMITTER CUTOUT PUSH BUTTON FOR NOISY LOCATIONS."

AUTOMATIC ELECTRIC COMPANY
CHICAGO, U.S.A.

PRINTED IN U.S.A.